



Assembly Instruction


Neutrik NC3MXX-HA

A




A Slide the boot onto the cable.

B

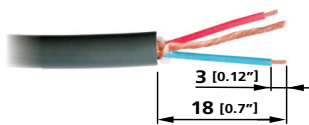

B Prepare cable as shown (twist the screen).

C

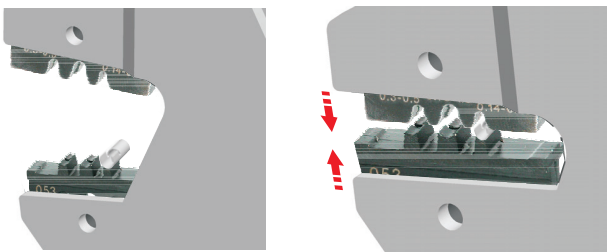


C Position a contact in the die and hold the contact by pressing the tool slightly together - DO NOT CRIMP!

D Position the wire in the contact & crimp it.

Repeat steps C, D, E for the remaining two contacts.

D

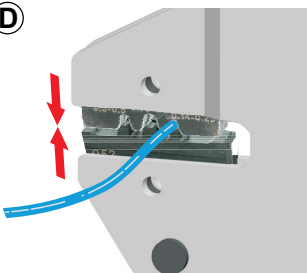


E Push the crimped contacts into the insert until you notice a snap.

Attention:
Align lug to the top!
Pay attention to correct wiring!

PIN 1 ... Screen
PIN 2 ... Hot, +
PIN 3 ... Cold, -

E

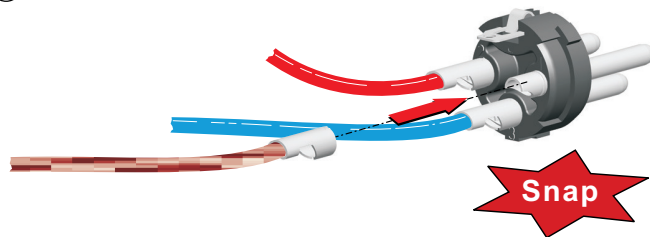

F Put the chuck onto the cable and align it with insert.

Attention: Pay attention to the guiding key.

G Slide the insert and the chuck into the housing.

H Finish the installation by screwing the bushing onto the connector.

Standard crimp according IEC 60352-2 (B crimp). Wire size AWG 22 - 24, 0.22 - 0.34 mm².

