

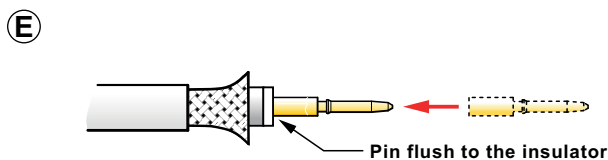
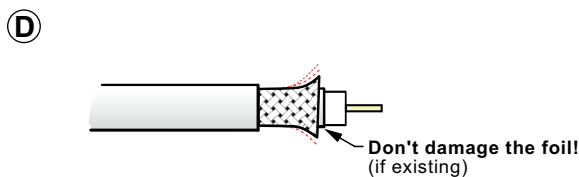


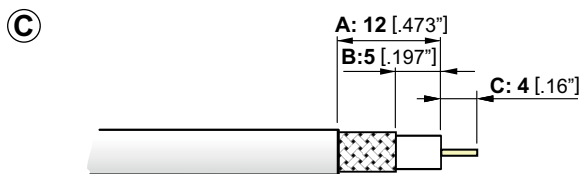

Assembly Instruction

Neutrik NBNC75BFG7-D BNC Plug Image 360

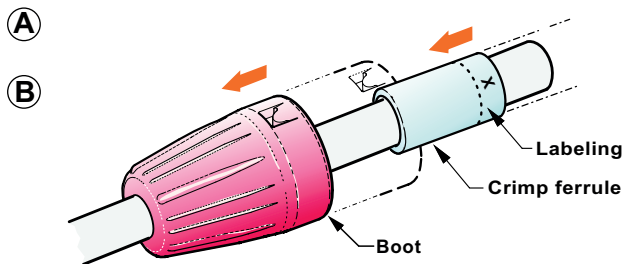


A Slide the boot onto the cable
- Position the labeling to the cabelend

B Slide the crimp ferrule onto the cable

C Prepare cable as shown
- Use an adjustable coaxial cable stripper

D Spread the braided shield

(It's easily with the NEUTRIK®
"SHIELD-SPREADING-TOOL"!)

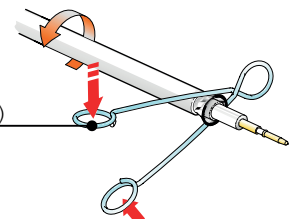

E Crimp the pin

- position the pin on the center conductor
- Crimp the pin with the tool


(For best crimping-results it is recommended to use the original Neutrik crimp tool

- HXBNC with the corresponding insert
- or hexcrimp acc. to IEC 803-W (SW 1.7)
- or squarecrimp acc. to IEC 803-2 (SW 1.6)

- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

F Insert the cable into the connector body

G Slide the crimp ferrule over the shield to the front and push the cable to it's end position until you hear a snap noise.

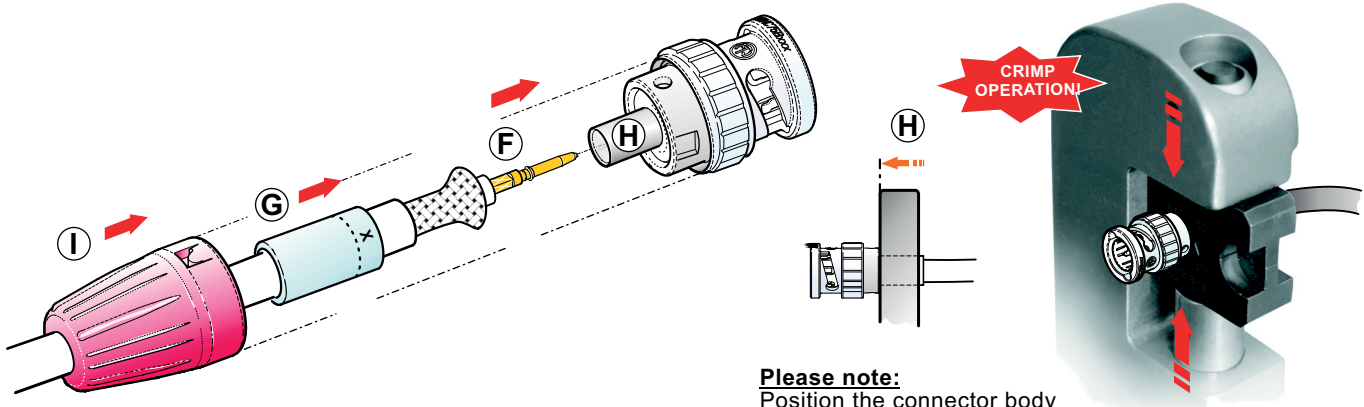

Please note:
Position the connector body
Flush with the die face.

H Crimp the ferrule with the tool

(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

I Snap the boot onto the connector body

Assembled Connector

