

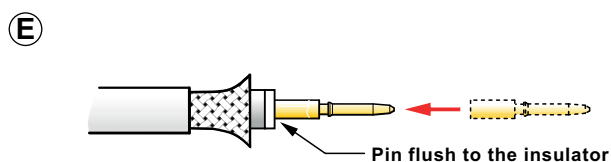
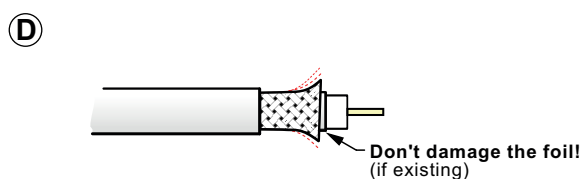


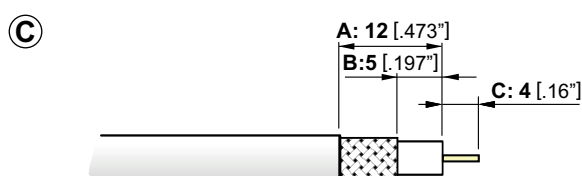


Assembly Instruction


Neutrik NBNC75BUU11-D BNC Plug 1694A/IMAGE 1000

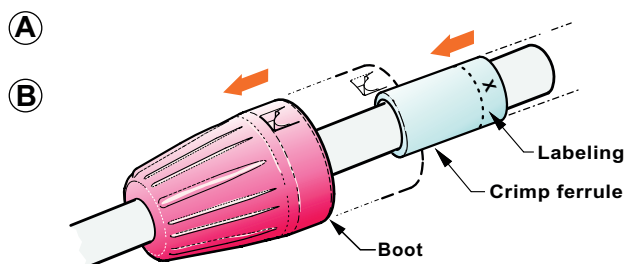

- A** Slide the boot onto the cable
- Position the labeling to the cabelend
- B** Slide the crimp ferrule onto the cable
- C** Prepare cable as shown
- Use an adjustable coaxial cable stripper
- D** Spread the braided shield

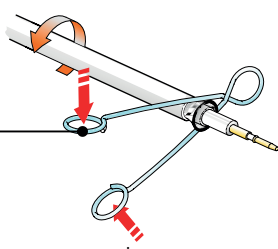
(It's easily with the NEUTRIK®
"SHIELD-SPREADING-TOOL"!) 

- E** Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- Pin can also be soldered (Optional!)
- Straighten the pin if misaligned.
- F** Insert the cable into the connector body
- G** Slide the crimp ferrule over the shield to the front and push the cable to it's end position until you hear a snap noise.

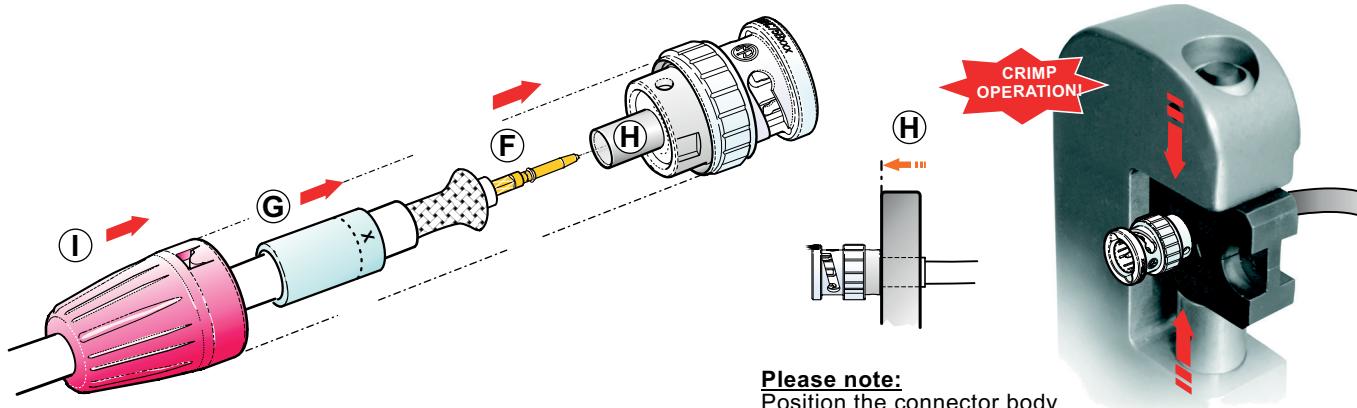

Please note:
Position the connector body
Flush with the die face.

Assembled Connector

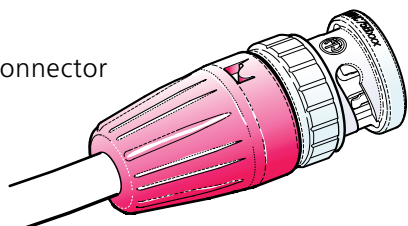

- H** Crimp the ferrule with the tool
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)
- I** Snap the boot onto the connector body